

Ship 21 Rev

Work Order ID 156038

156038

Page 1

Tuesday, January 24, 2017 10:06:22 AM

Item ID: D117-762-011

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Skidtube with Standard Wearplates Fits LH or RH

Start Date: 2/1/2017 Start Qty: 1.00 *1*

Cust Item ID:

Required Date: 2/13/2017 Req'd Qty: 1.00 *1*

Customer:

Reference:

Approvals: Process Plan:  Date: JAN 24 2017 Tooling: _____ Date: _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
DSI9771	A								
IIN-D117-762	E	FEB 02 2017							
100	Document Control	0.00							
100	DOCUMENT CONTROL								
DC	Memo	0.25							
Doc.Control -USB or Paperwork	Photocopy bluefile & type labels per PPP D117-762-011	CHG004							
110	Pick Kit	0.00							
110									
Packaging	Memo	0.00							
Packaging									

B155915

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Work Order ID 156038***156038***

Page 2

Tuesday, January 24, 2017 10:06:22 AM

Item ID: D117-762-011**Accept*****N900040100*****Setup Start*****NS1*****Revision ID:****Stop*****NS2*****Item Name:** Skidtube with Standard Wearplates Fits LH or RH**Start Date:** 2/1/2017 **Start Qty:** 1.00 ***1*****Cust Item ID:****Required Date:** 2/13/2017 **Req'd Qty:** 1.00 ***1*****Customer:****Reference:****Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start*****NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop*****NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	QC4- 100% Inspect kits for completeness	0.00							
120									
QC	Memo	0.01							
Quality Control									
130	Packaging	0.00							
130									
Packaging	Memo	0.00							
Packaging	Identify and pack for shipping as per PPP D117-762-011 Location :FG081								
140	QC21- Final Inspection - Work Order Release	0.00							
140									
QC	Memo	0.02							
Quality Control									

DAS
28
9-89

FEB 23 2017

DAS
27
9-89DAS
28
9-89

FEB 23 2017

17/2/23

CMF
17-2-23

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Picklist Print

Tuesday, January 24, 2017 10:06:30 AM

Page 1

Work Order ID: 156038

156038

Parent Item: D117-762-011

D117-762-011

Parent Item Name: Skidtube with Standard Wearplates Fits LH or RH

Start Date: 2/1/2017

Required Date: 2/13/2017

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A07.06.11New Issue EC
 IPP Rev:B 08-02-22 change to revA DD verified by:ec
 IPP Rev C 08.12.19 incorporated DSI9435 EC verified by:DD
 IPP REV:D 13.11.14 IIN REV.C DD VERF:JLM IPP
 REV:E 15.06.11 IIN REV.D DD VERF:JLM IPP REV:F
 17.01.17 PER CHG004 (dsi9771) DD VERF:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
AN6C52A *AN6C52A* BOLT		Purchased	No			110	Each	19.0000	2	2			
					<u>Location</u>			<u>Loc Qty</u>		<u>Loc Code</u>			
					ST333			19					
					m134535			19					
D5300-1 *D5300-1* GHL Bushing		Manufactured	No			110	Each	2.0000	2	2			
					<u>Location</u>			<u>Loc Qty</u>		<u>Loc Code</u>			
					ST163			2					
					141838			2					
D5301-1 *D5301-1* GHL Plug		Manufactured	No			110	Each	0.0000	2	2			
D117-762-041 *D117-762-041* Replacement Skidtube		Manufactured	No			110	Each	0.0000	1	1			

DAS
28
9-89

DAS
28
9-89

DAS
28
9-89

DAS
28
9-89

**

**

**

**

DAS
6
9-89

FEB 07 2017

156514 FEB 23 2017

DAS
6
9-89

156514

FEB 23 2017

155915

DAS
27
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
3								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : _____			

Picklist Print

Tuesday, January 24, 2017 10:06:30 AM

Page 2

Work Order ID: 156038

156038

Parent Item: D117-762-011

D117-762-011

Parent Item Name: Skidtube with Standard Wearplates Fits LH or RH

Start Date: 2/1/2017

Required Date: 2/13/2017

Start Qty: 1.00

Required Qty: 1.00

D3512-041

Manufactured No

110 Each

10.0000

2 2

D3512-041

Wearplate

**

DAS
28
9-89

Location

Loc Qty

Loc Code

ST610

10

153703

10

MS21043-6

Purchased No

110 Each

100.0000

2 2

MS21043-6

NUT

**

DAS
28
9-89

Location

Loc Qty

Loc Code

FG

20

103693

20

FP001

59

m135470

2

m136295

57

ST302

21

m136648

21

DAS
28
9-89

FEB 07 2017

DAS
27
9-89

DAS
6
9-89

FEB 07 2017

DAS
27
9-89

Tuesday, January 24, 2017 10:06:30 AM

Shop Packet Print

Page 2

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
3								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : _____							

DART SERVICE INSTRUCTION

TO AMEND INSTALLATION INSTRUCTIONS IIN-D117-762 REV. E AND INSTRUCTIONS FOR CONTINUED AIRWORTHINESS ICA-D117-762 REV. 4

REF FAA STC: SR01853SE

REF: TC LETTER OF ACCEPTANCE RDIMS-4374899

REF EASA STC: EASA.10017063

1.0 PURPOSE

The purpose of this Dart Service Instruction (DSI) is to replace the ground handling lugs (D3864-1 Bushings, AN6C51A Bolts and MS21043-6 Nuts) on the D117-762-XXX Skid tubes with a structurally superior lug design (D5300-1 Bushings, D5301-1 Plugs, AN6C52A Bolts, MS21043-6 Nuts) as shown in Figure 1. The new hardware will be included in D117-762-011 @ CHG 004 and subsequent.

2.0 INSTALLATION

For D117-762-011 @ CHG 004 and subsequent, the ground handling hardware should be installed as follows:

- 2.1 Loosely install (qty 2) D5300-1 GHL Bushing & (qty 2) D5301-1 GHL Plug wet with Proseal 890 or MIL-S-8802 Class B2 Sealant in location shown in Figure 1.
- 2.2 Install (qty 2) AN6C52A Bolts and (qty 2) MS21043-6 Nuts in accordance with Figure 1. Clean up squeezed out Proseal and apply fillet seal around D5300-1 & D5301-1.
- 2.3 Torque AN6C52A Bolts 160 - 190 in-lbs (18.1 - 21.5 N-m).

3.0 PARTS LIST

For D117-762-011 @ CHG 004 and subsequent, the Part List in IIN-D117-762 and ICA-D117-762 is modified as follows:

IS

ITEM	QTY -011	PART NUMBER	DESCRIPTION
	X	D117-762-011	SKIDTUBE INSTALLATION
50	2	AN6C52A	BOLT
51A	2	D5300-1	GHL BUSHING
51B	2	D5301-1	GHL PLUG
52	2	MS21043-6	NUT

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 156038 MP

JAN 24 2017

A	NEW ISSUE	RF	17.01.09
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE, LTD EUGENE, OR	
DRAWN	RF		
CHECKED	WK	DRAWING NO.	REV.A
MFG. APPR.	N/A	DSI 9771	SHEET 1 OF 2
APPROVED	HS	TITLE	SCALE
DE APPR.		GHL UPGRADE KIT	NTS
DATE	17.01.09	COPYRIGHT ©2017 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE, LTD.	

WAS

ITEM	QTY -011	PART NUMBER	DESCRIPTION
	X	D117-762-011	SKIDTUBE INSTALLATION
50	2	AN6C51A	BOLT
51	4	D3864-1	BUSHING
52	2	MS21043-6	NUT

4.0 WEIGHT AND BALANCE

There is negligible weight and balance change associated with this modification.

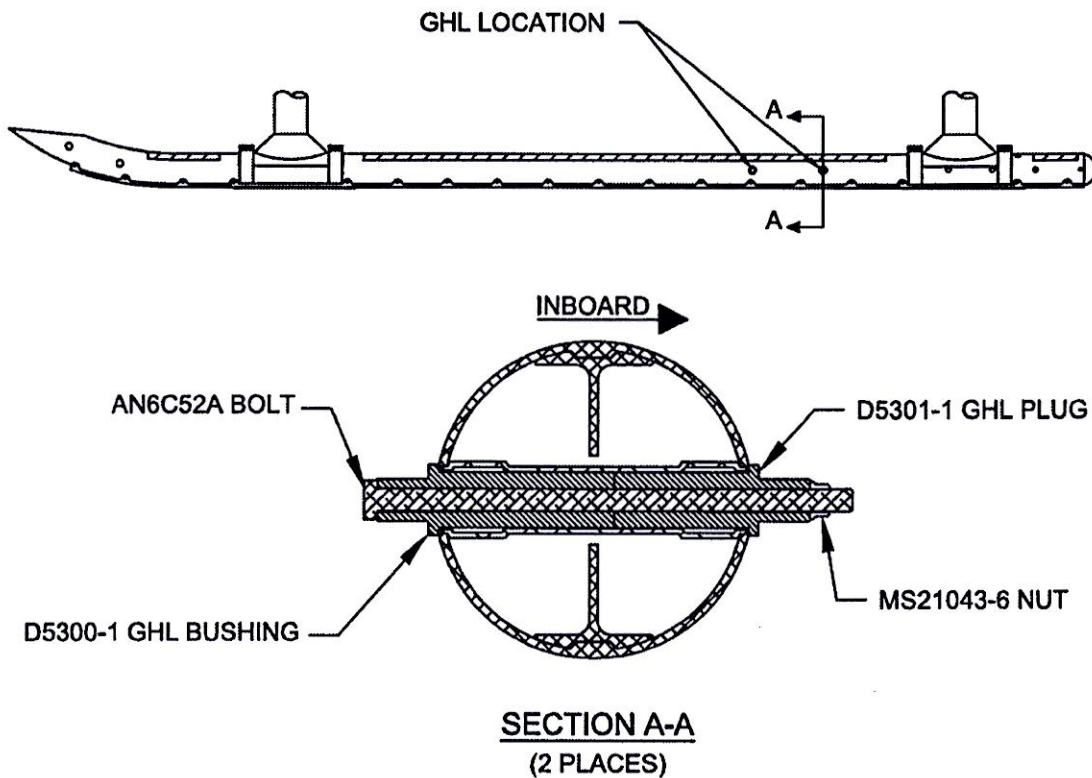


FIGURE 1 - GH L UPGRADE INSTALLATION

DESIGN	RF	DART AEROSPACE, LTD	
DRAWN	RF	EUGENE, OR	
CHECKED	WK	DRAWING NO.	REV.A
MFG. APPR.	N/A	DSI 9771	SHEET 2 OF 2
APPROVED	HS	TITLE	SCALE
DE APPR.		GH L UPGRADE KIT	NTS
DATE	17.01.09	COPYRIGHT © 2017 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE, LTD.	

Work Order ID 156038***156038***

Page 1

Tuesday, February 07, 2017 1:13:20 PM

Item ID: D117-762-011**Accept*****N900040100*****Setup Start *NS1*****Revision ID:****Stop *NS2*****Item Name:** Skidtube with Standard Wearplates Fits LH or RH**Start Date:** 2/1/2017 **Start Qty:** 1.00 ***1*****Cust Item ID:****Required Date:** 2/13/2017 **Req'd Qty:** 1.00 ***1*****Customer:****Reference:****Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start *NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop *NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
DSI9771	A								
IIN-D117-762	E								
100	Document Control	0.00							
100	DOCUMENT CONTROL								
DC	Memo	0.25							
Doc.Control -USB or Paperwork	Photocopy bluefile & type labels per PPP D117-762-011		CHG004						
110	Pick Kit	0.00							
110									
Packaging	Memo	0.00							
Packaging									

DAS
21
9-89

FEB 07 2017

DART SERVICE INSTRUCTION

TO AMEND INSTALLATION INSTRUCTIONS IIN-D117-762 REV. E AND
INSTRUCTIONS FOR CONTINUED AIRWORTHINESS ICA-D117-762 REV. 4

REF FAA STC: SR01853SE

REF: TC LETTER OF ACCEPTANCE RDIMS-4374899

REF EASA STC: EASA.10017063

1.0 PURPOSE

The purpose of this Dart Service Instruction (DSI) is to replace the ground handling lugs (D3864-1 Bushings, AN6C51A Bolts and MS21043-6 Nuts) on the D117-762-XXX Skidtubes with a structurally superior lug design (D5300-1 Bushings, D5301-1 Plugs, AN6C52A Bolts, MS21043-6 Nuts) as shown in Figure 1. The new hardware will be included in D117-762-011 @ CHG 004 and subsequent.

2.0 INSTALLATION

For D117-762-011 @ CHG 004 and subsequent, the ground handling hardware should be installed as follows:

- 2.1 Loosely install (qty 2) D5300-1 GH L Bushing & (qty 2) D5301-1 GH L Plug wet with Proseal 890 or MIL-S-8802 Class B2 Sealant in location shown in Figure 1.
- 2.2 Install (qty 2) AN6C52A Bolts and (qty 2) MS21043-6 Nuts in accordance with Figure 1. Clean up squeezed out Proseal and apply fillet seal around D5300-1 & D5301-1.
- 2.3 Torque AN6C52A Bolts 160 - 190 in-lbs (18.1 - 21.5 N-m).

3.0 PARTS LIST

For D117-762-011 @ CHG 004 and subsequent, the Part List in IIN-D117-762 and ICA-D117-762 is modified as follows:

IS

ITEM	QTY -011	PART NUMBER	DESCRIPTION
	X	D117-762-011	SKIDTUBE INSTALLATION
50	2	AN6C52A	BOLT
51A	2	D5300-1	GH L BUSHING
51B	2	D5301-1	GH L PLUG
52	2	MS21043-6	NUT

A	NEW ISSUE	RF	17.01.09
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE, LTD EUGENE, OR	
DRAWN	RF		
CHECKED	WK	DRAWING NO.	REV.A
MFG. APPR.	N/A	DSI 9771	SHEET 1 OF 2
APPROVED	HS	TITLE	SCALE
DE APPR.		GHL UPGRADE KIT	NTS
DATE	17.01.09	COPYRIGHT ©2017 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE, LTD.	

5.0 PARTS LIST

5.1 D117-762-011 Skidtube Parts List

Item	Qty -011	Qty -041	Part Number	Description
	X		D117-762-011	SKIDTUBE INSTALLATION
	1	X	D117-762-041	REPLACEMENT SKIDTUBE
1		1	D3582-041	SKIDTUBE ASSEMBLY
2	2		**1121-51002	SKID SHOE
3	2		**1121-51102	CLAMPING RING
4	8		**LN9380M8X45	HEXAGON BOLT
5	8		**LN9023A8-1.4544.9	LOCKING WASHER
6	8		**LN9025-0815K	WASHER (OR LN9025-0815L)
10		1	*D2965	CAP
11		2	***AELS-1032-225	INSERT
12		2	*AN3C5A	BOLT
13		2	*NAS1149C0332R	WASHER (OR AN960C10L)
20A		1	*D3508-9	WEARPLATE
20B		1	*D3558-9	GASKET
21A		1	*D3508-3	WEARPLATE
21B		1	*D3558-3	GASKET
22A		1	*D3508-11	WEARPLATE
22B		1	*D3558-11	GASKET
23A		1	*D3508-13	WEARPLATE
23B		1	*D3558-13	GASKET
24		36	*AELS-1032-130	INSERT
25	8	28	*AN3C4A	BOLT
26	8	28	*NAS1149C0332R	WASHER (OR AN960C10L)
27	2		D3512-041	WEARPLATE
30		2	*AELS-1032-130	INSERT
31		2	*AN3C4A	BOLT
32		2	*NAS1149C0332R	WASHER (OR AN960C10L)
50	2		AN6C51A	BOLT
51	4		D3864-1	BUSHING
52	2		MS21043-6	NUT

* PART IS INCLUDED WITH D3582-041 SKIDTUBE ASSEMBLY

** TO BE SUPPLIED BY CUSTOMER, LISTED AS REFERENCE ONLY

*** DENOTES PART IS INCLUDED WITH ASSEMBLY ABOVE